

# 1D- / 2D- Inclination Sensors with Voltage Interface



## IS1A xx P20 / IS2A xx P20

### Characteristics:

- 1- and 2-dimensional inclination sensors with measurement range:  $\pm 10^\circ$  /  $\pm 45^\circ$  /  $\pm 60^\circ$  (depending on type)
- High resolution and accuracy
- 0...10 V voltage interface
- Robust, simply mountable aluminium housing
- Suitable for industrial use:
  - Temperature range: -40 °C to +80 °C
  - Degree of protection: IP65/67




The inclination sensor IS1A xx P20 enables, depending on type, the one-channel measurement of inclinations in the ranges  $\pm 10^\circ$ ,  $\pm 45^\circ$  or  $\pm 60^\circ$ . The inclination sensor IS2A xx P20 includes two channels. The full-scale readings are calibrated factory-made at 25°C.

The compact and robust design makes the sensor a suitable angle measurement device in rough surroundings for different applications in industry and automotive technology.

### Applications:

- Industry automation
- Agricultural and forestry machines
- Utility vehicles
- Crane and hoisting technology

Sensors

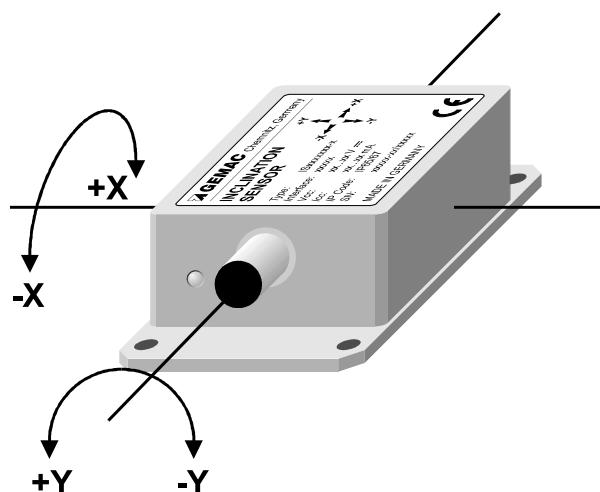


## Technical Data:

General Parameters	
Measurement axes	1 axis (IS1A xx P20), 2 axes (IS2A xx P20)
Measurement ranges	$\pm 10^\circ / \pm 45^\circ / \pm 60^\circ$
Resolution (at zero point)	0.01° / 0.05° / 0.05°
Calibration accuracy (at 25° C)	$\pm 0.3^\circ / \pm 0.7^\circ / \pm 1.5^\circ$ (zero point and accumulated values)
Nonlinearity (sine)	Max. $\pm 0.2^\circ / \pm 0.3^\circ / \pm 0.4^\circ$
Temperature coefficient (zero point)	Max. $\pm 0.009^\circ/\text{K} / \pm 0.009^\circ/\text{K} / \pm 0.009^\circ/\text{K}$
Cross Sensitivity	Max. 5%
Critical frequency	typ. 18 Hz
Operating temperature	-40 °C to +80 °C
Characteristics	
Interface	voltage output 0...10 V
Electrical Parameters	
Supply voltage	11 V DC to 30 V DC
Current consumption	23 mA to 33 mA
Mechanical Parameter	
Connector	sensor connector 5-pole (M12) IEC 61076-2-101, IEC 60947-2
Degree of protection	IP65/67 min.locking torque of connector 0,9 Nm
Shock survival	max. 3,500 g
Dimensions	58 mm x 90 mm x 31 mm
Mass	about 200 g

## Dimensioned Drawing:


The four bores for fixing the sensors are situated in the basic plate of the inclination sensor. The additional M5 press-in bolt is used as mass-connector.

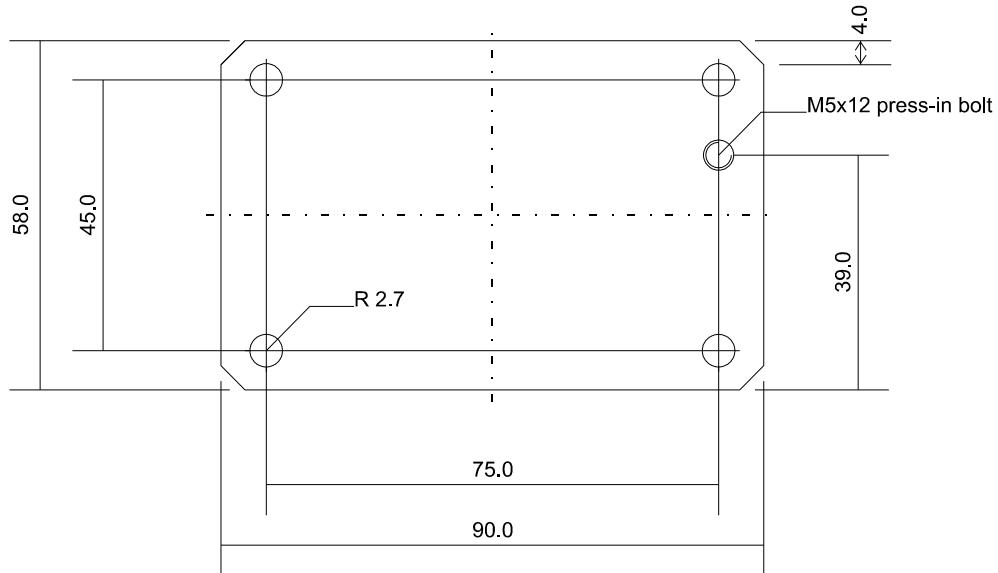

Dimensions in mm

## Plug Connector Allocation:

Pin	Allocation
1	Supply voltage
2	Sensor signal Y-axis
3	GND
4	Sensor signal X-axis
5	Reference potential for sensor signal

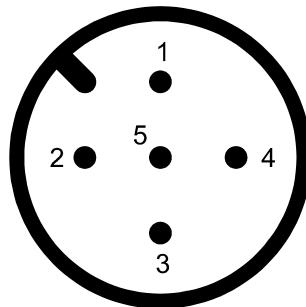

(View from the outside)

## Ordering Information:

Type	Description/Distinction	Article Number
IS1A 10 P20	1-dimensional, $\pm 10^\circ$ , 0...10 V	PR-24100-00
IS1A 45 P20	1-dimensional, $\pm 45^\circ$ , 0...10 V	PR-24101-00
IS1A 60 P20	1-dimensional, $\pm 60^\circ$ , 0...10 V	PR-24102-00
IS2A 10 P20	2-dimensional, $\pm 10^\circ$ , 0...10 V	PR-24300-00
IS2A 45 P20	2-dimensional, $\pm 45^\circ$ , 0...10 V	PR-24301-00
IS2A 60 P20	2-dimensional, $\pm 60^\circ$ , 0...10 V	PR-24302-00